

Additional Resources: Product Page

date 03/03/2025

page 1 of 3

MODEL: HSE13-254225P | DESCRIPTION: HEAT SINK

FEATURES

- TO-220 package
- · bolt on attachment
- pins for secure PCB attachment
- aluminum alloy





thermal resistance1 power dissipation¹ @ 75°C ∆T, nat @ 1 W, @ 75°C ∆T, nat @ 1 W, @ 1 W, 400 LFM conv (°C/W) 200 LFM nat conv conv $(^{\circ}C/W)$ (°C/W) (°C/W) (W) 11.47 12.5 4.3 2.7 6.54 HSE13-254225P


Note: 1. See performance curves for full thermal resistance details.

PERFORMANCE CURVES

	Heatsink Temperature Rise Above Ambient (ΔT = Ths - Ta) (°C)		
Power (W)	Natural Conv.	200 LFM	400 LFM
0	0	0	0
1	12.5	4.3	2.7
2	23.8	8.3	5.2
3	35.6	12.4	8.0
4	47.7	16.8	10.6
5	58.9	21.1	13.4
6	69.6	25.4	16.3
7	79.7	29.6	18.8
8	89.9	34.0	21.6
9	99.3	38.6	24.5
10	108.9	42.9	27.4

Ths: "hot spot" temperature measured on the heatsink

Ta: ambient temperature

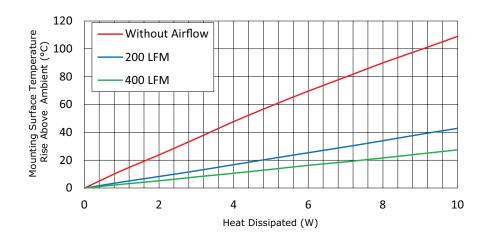


MECHANICAL DRAWING

units: mm

tolerance: ±0.50 mm

MATERIAL	AL 6063-T5
FINISH	black anodized
PIN MATERIAL	steel
PIN PLATING	2~3 µm tin
WEIGHT	19.3 g

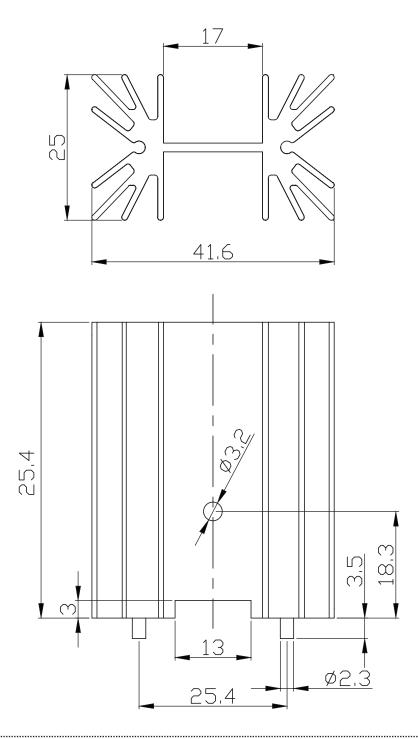

Additional Resources: Product Page

SAME SKY | MODEL: HSE13-254225P | DESCRIPTION: HEAT SINK date 03/03/2025 | page 3 of 3

REVISION HISTORY

rev.	description	date
1.0	initial release	03/03/2025

The revision history provided is for informational purposes only and is believed to be accurate.



Same Sky offers a one (1) year limited warranty. Complete warranty information is listed on our website.

Same Sky reserves the right to make changes to the product at any time without notice. Information provided by Same Sky is believed to be accurate and reliable. However, no responsibility is assumed by Same Sky for its use, nor for any infringements of patents or other rights of third parties which may result from its use.

Same Sky products are not authorized or warranted for use as critical components in equipment that requires an extremely high level of reliability. A critical component is any component of a life support device or system whose failure to perform can be reasonably expected to cause the failure of the life support device or system, or to affect its safety or effectiveness.